

SERVICE BULLETIN

0004

Service bulletins are issued by *Maine Energy Systems* at irregular intervals to alert Installers of common issues of installations and are also used to pass information of interest concerning parts replacement that may be considered unusual or unscheduled for boilers already in service.

Subject: CMP software 6.08 - 6.09 and 6.09a default value for hopper re-fill too high

Models: All vacuum boilers with CMP software 6.08 or 6.09 / 6.09a

Problem: Boilers with this software are subject to running out of pellets before the timer calls for re-filling the on board pellet hopper / vacuum tank.

Solution: *Reset P285 to:*

On 36 / 48 / 56 KW boilers – from default of 100 to new setting of 50

On 25 / 32 KW boilers – from default of 200 to new setting of 100

On 12 / 16 / 20 KW boilers – from default of 175 to new setting of 85

CAUTION!!!

NOTE: